687

Optical Touch Switch

SERIES

FIBER SENSORS

Related Information ■ General terms and conditions......F-3

■ General precautions P.1595

LASER SENSORS PHOTOELECTRIC

MICRO

PHOTOELECTRIC SENSORS

AREA SENSORS

PRESSURE / FLOW SENSORS INDUCTIVE PROXIMITY **SENSORS**

PARTICUI AR USE SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASUREMENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

FNFRGY MANAGEMENT SOLUTIONS

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Selection Guide Safety Light Curtains Safety Control Units

ST4

SW-100

Safety Devices







Conforming to OSHA / ANSI



This product is used to start up the machinery. Do not use this product as a device for emergency stop.

panasonic.net/id/pidsx/global

Gentle start-up switches in accordance with ergonomics

Greater convenience with less stress on the hands. Inventive start-up switches in accordance with ergonomics.

Sensing surface

Beam axes



Operate the switch simply by touching it

This is an optical-type switch (two beam axes) which allows you to start equipment simply by touching the sensing surface to interrupt the light beams.



Reduces load on hands and fingers

Provides a zero force, low impact, machine control solution.



Prevents medical issues

The switch reduces the possibility of medical problems that are associated with high impact push buttons, such as tendonitis or carpal tunnel syndrome.

Reduction in false operation from dropped objects

SW-101

The response time is set for a slight delay so that the switch will not respond a falling object, such as a dropped tool. The switch is designed so that it will operate when touched by hand, but false operation will rarely occur when something is dropped onto it.



A switch that pursues the prevention requirement for malfunctioning as required by ISO 13851 (JIS B 9712) two-hand control devices

SW-111



Safeguard prevents false operation

SW-111 saves the hassle of making an additional safeguard. In addition, with its ISO 13851 complying shape, even a knock on the elbow will not cause a false operation (light interruption).

No false operation by wrist



No false operation by elbow




No false operation by plastic sheet



Experimental cone (ISO 13851)

SW-111 does not produce false operation on the experimental cone specified by ISO 13851.

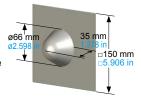

Intended startup is possible

SW-111's detection does not operate when a hand is just placed onto the unit.

With a design that only detects when fingers are bent in and lightly grip onto the unit, an intended startup is possible.



Detection does not operate when a hand is only placed onto the unit.



Detection only operates when fingers are bent in and lightly grip onto the unit.




Application example

When used as two-hand control devices

Equipped with external input indicators

Two sets of external input indicators (two colors) are provided, so that they can be used as operation indicators for a variety of purposes.

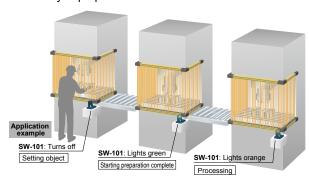

Prevents false operation caused by dirt

If the light is continuously interrupted for more than 10 sec. by dust, etc., the switch is disabled and the fault indicator (yellow) illuminates.

Uses a long-life Photo-MOS relay

Because a Photo-MOS relay is used for the output, a single unit can be configured without a specific output polarity. In addition, there is no need for periodic replacement of parts such as contact-type relays.

FIBER SENSORS

LASER SENSORS

PHOTOELECTRIC SENSORS

MICRO PHOTOELECTRIC SENSORS

AREA SENSORS

PRESSURE / FLOW SENSORS INDUCTIVE PROXIMITY **SENSORS**

PARTICUI AR USE SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASUREMENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

PLC

SW-111

HUMAN MACHINE INTERFACES

FNFRGY MANAGEMENT SOLUTIONS

FA COMPONENTS

MACHINE VISION SYSTEMS

UV CURING

Selection Guide Safety Light Curtains Safety Control Units

ST4

SW-100

Safety Devices

FIBER SENSORS

LASER SENSORS

PHOTO-ELECTRIC SENSORS MICRO PHOTO-ELECTRIC

AREA SENSORS

COMPONENTS

PRESSURE /
FLOW
SENSORS

INDUCTIVE PROXIMITY SENSORS PARTICULAR USE SENSORS

SENSOR OPTIONS SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS STATIC CONTROL DEVICES

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

MANAGEMENT SOLUTIONS

COMPONENTS

MACHINE

MACHINE VISION SYSTEMS

UV CURING SYSTEMS

Selection Guide Safety Light Curtains Safety Control Units

ST4

Safety Devices

ORDER GUIDE

| Designation | Appearance | Model No. | Power supply | Output |
|----------------------|------------|-----------|--------------|--|
| Optical touch switch | | SW-101 | 12 to 24V DC | Semiconductor Photo-MOS relay output × 3 |
| With safeguard | | SW-111 | ±10 % | |

OPTIONS

| Designation | Model No. | Description | |
|--|-----------|--|--|
| Mounting tool | SW-MT1 | Tool for tightening mounting nuts with a commercially-available wrench. (Refer to p.691) | |
| Sensing surface protective sheet for SW-101 SW-PS1 | | A transparent stick-on sheet that protects the sensing surface of SW-101 from dirt and scratches. 5 sheets per set | |

Sensing surface protective sheet for SW-101



SPECIFICATIONS


| Decimantian | | D ! #! | Optical touch switch | | | | |
|---------------------------------|--|---|--|--|--|--|--|
| | | Designation | | With safeguard | | | |
| Item | · _ | Model No. | SW-101 | SW-111 | | | |
| Sensing method | | | Thru-beam type photoelectric sensor (2 beam axes) | | | | |
| Applicable standards | | ırds | CSA 22.2 No.14, CSA 22.2 No.0.8, ANSI/NFPA 79, UL 508, EN 60947-5-2 (EMC only) | | | | |
| CE marking directive compliance | | ve compliance | EMC Directive, RoHS Directive | | | | |
| Power supply | | | 12 to 24 V DC ±10 % Ripple P-P 10 % or less | | | | |
| Current consumption | | tion | 100 mA or less (excluding external connection load) | | | | |
| Outputs | | | Semiconductor Photo-MOS relay output × 3 • Maximum load current: 100 mA • Applied voltage: 30 V DC or less (between output and +V) • Residual voltage: 1.5 V or less (at 100 mA of load current) | | | | |
| Output operation | | ation | Output 1 : When an object is detected (beam is interrupted): OFF / When an object is not detected (beam is received): ON Output 2, 3 : When an object is detected (beam is interrupted): ON / When an object is not detected (beam is received): OFF | | | | |
| Short-circuit protection | | protection | Incorporated | | | | |
| Response time | | | 100 ms or less when an object is detected, 50 ms or less when an object is not detected | | | | |
| Time-out function | | | Switchable either effective or ineffective by short-circuiting terminals (disabled when short-circuited) | | | | |
| External input | | | 0 to 1 V or 10 V to +V: Valid (External input indicator lights up), 4 to 6 V or Open: Invalid (External input indicator lights off) | | | | |
| | Power indica | ator (POWER) | Green LED (lights up when the power is ON) | | | | |
| | Operation indicator (OPE.) | | Green LED (lights up when an object is detected) | | | | |
| External input inc | | ut indicator 1 | Green LED (lights up when external input 1 is valid) | | | | |
| External input indicator 2 | | ut indicator 2 | Orange LED (lights up when external input 2 is valid) | | | | |
| | Fault indicator (FAULT) | | Yellow LED (blinks or lights up when fault occurs) | | | | |
| Protection | | | IP65 (IEC), TYPE 1 (UL 50) (excluding terminal part) | | | | |
| Ambient temperature | | nperature | -25 to +50 °C −13 to +122 °F (No dew condensation or icing allowed), Storage: -30 to +70 °C -22 to +158 °F | | | | |
| sist | Ambient hur | midity | 30 to 85 % RH, Storage: 30 to 85 % RH | | | | |
| al re | Ambient temperature Ambient humidity Ambient illuminance Voltage withstandability Insulation resistance Vibration resistance | | Incandescent light: 3,000 & or less at the light-receiving face | | | | |
| nent | Voltage with | standability | 1,000 V AC for one min. between all supply terminals connected together and enclosure | | | | |
| ron | Insulation resistance | | 20 M Ω , or more, with 500 V DC megger between all supply terminals connected together and enclosure | | | | |
| Vibration res | | sistance | 10 to 500 Hz frequency, 3 mm 0.118 in double amplitude in X, Y and Z directions for two hours each 10 to 150 Hz frequency, 0.75 mm 0.030 in double amplitude in X, Y and Z directions for two hours each | | | | |
| Shock resist | | ance | 500 m/s ² acceleration (50 G approx.) in X, Y and Z directions three times each | | | | |
| Removable-type terminals | Connector | 3.5 mm 0.138 in pitch, 2-level socket: 12 pins | | | | | |
| | Terminal part | 3.5 mm 0.138 in pitch spring-cage terminals: 6 pins × 2 (FMC1,5/6-ST-3,5GS manufactured by Phoenix Contact) | | | | | |
| Cable | | | 0.2 to 1.5 mm ² [including single wire or ferrule (sleeve)] | | | | |
| Maximum cable length | | ength | Up to 20 m 65.617 ft (for cable from 0.2 to 0.3 mm²), Up to 100 m 328.084 ft (for cable from 0.3 to 1.5 mm²) | | | | |
| Material | | | Enclosure: Polycarbonate, Polyester, O-ring: Silicone rubber, Mounting nut: PBT, Mounting packing: Silicone rubber | | | | |
| Weight | | | Net weight: 130 g approx., Gross weight: 200 g approx. | Net weight: 150 g approx., Gross weight: 220 g approx. | | | |

Note: Where measurement conditions have not been specified precisely, the conditions used were an ambient temperature of +23 °C +73.4 °F.


I/O CIRCUIT DIAGRAMS

I/O circuit diagram

If case of connecting output to Minus common

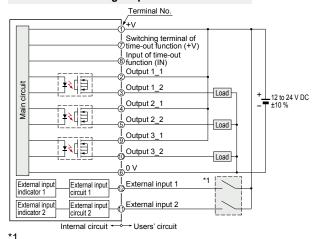


Non-voltage contact or PNP open-collector transistor

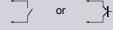


Contact "closed" or transistor "ON": Valid (External input indicator lights up)
Contact "open" or transistor "OFF": Invalid (External input indicator lights off)


Terminal arrangement diagram

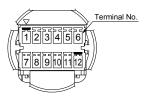

If case of connecting output to Plus common

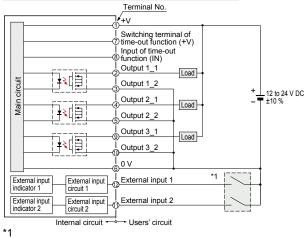

Non-voltage contact or NPN open-collector transistor

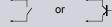

Contact "closed" or transistor "ON": Valid (External input indicator lights up) Contact "open" or transistor "OFF": Invalid (External input indicator lights off)

FIBER SENSORS

LASER SENSORS

PHOTO-ELECTRIC SENSORS MICRO PHOTO-ELECTRIC SENSORS

AREA SENSORS

SAFETY LIGHT CURTAINS / SAFETY COMPONENTS PRESSURE / FLOW SENSORS

INDUCTIVE PROXIMITY SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS SIMPLE

SIMPLE WIRE-SAVING UNITS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES

ENERGY MANAGEMENT SOLUTIONS

FA COMPONENTS MACHINE

UV CURING SYSTEMS

Selection Guide Safety Light Curtains

Safety Control Units Safety Components

ST4

SW-100 Safety Devices FIBER SENSORS

LASER SENSORS

PHOTO-ELECTRIC SENSORS MICRO

> AREA SENSORS

SAFETY LIGHT CURTAINS SAFETY COMPONENTS PRESSURE FLOW

SENSORS

INDUCTIVE
PROXIMITY
SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

SIMPLE WIRE-SAVING UNITS

SYSTEMS MEASURE-

MENT SENSORS

CONTROL

LASER MARKERS PLC

HUMAN MACHINE INTERFACES

MANAGEMENT SOLUTIONS

FA COMPONENTS

MACHINE VISION SYSTEMS

> UV CURING SYSTEMS

Selection Guide Safety Ligh Curtains Safety Control Units

ST4

SW-100 Safety Devices

PRECAUTIONS FOR PROPER USE

 Never use this product in a device for personnel protection.

- In case of using devices for personnel protection, use products which meet laws and standards, such as OSHA, ANSI or IEC etc., for personnel protection applicable in each region or country.
- Do not use this product as a device for emergency stop.
- This product is used to start up the machinery. Securing safety for the startup of machinery should be performed separately.



- When using the products for two-hand control, comply with the following contents.
- Select a model of a control device for two-hand control, based on results of risk assessment
- Make sure to use a controller for two-hand control which complies with ISO 13851 (EN 574, JIS B 9712)
- For another requirements such as mounting of this product, or prevention of accidental actuation and of defeat etc., comply with ISO 13851 (EN 574, JIS B 9712) and ANSI B11.1, B11.9. Furthermore, comply with the regulations established by national or regional security committees (Occupational Safety and Health Administration: OSHA, the European Standardization Committee, etc.)


Mounting

 Fasten a mounting nut (accessory) from the reverse side of the mounting plate. (Note 1)

The tightening torque should be 2 to 3 N·m.

Notes: 1) A mounting tool (**SW-MT1**) for fastening the mounting nut is available separately. The shape of fastening part of **SW-MT1** is M10 nut.

 Make sure to use the attached mounting packing, or waterproof property will be invalid.

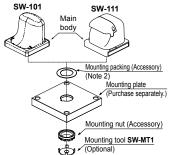


Time-out function

• Unintended beam interrupted status caused by dirt on the sensing surface, etc. can be monitored.

When beam interrupted status (sensing status) continues for 10 sec. or more, output 1 turns ON and output 2 and 3 turn OFF (output status is the same as non-sensing status.)

This function can be invalid by short-circuiting "between switching terminals of time-out function (terminal No. 7 and No. 8)" as described below.

Note: When time-out function is operated, the fault indicator (yellow) lights up. In this case, once beam is received, the fault indicator lights off and the sensor returns to normal operation.

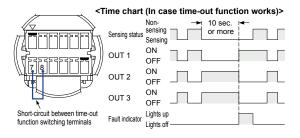

Others

- This device has been developed / produced for industrial use only.
- When the power of the thru-beam type photoelectric sensor inside the main body turns on in beam interrupted status, output 1 turns ON and output 2 and 3 turn OFF, then the fault indicator (yellow) lights up. In this case, once beam is received, the fault indicator lights off and the sensor returns to normal operation.
- Use a power supply unit conforming to the EMC Directive and the Low Voltage Directive. (Only for use in Europe)
- Use a power supply unit conforming to Class 2. (Only for use in the North America)
- Use a power supply unit with an output holding time of 20 ms or more.
- Do not use during the initial transient time (300 ms approx.) after the power supply is switched on.

DIMENSIONS (Unit: mm in)

The CAD data can be downloaded from our website.

/M30 × 1.5 0.059

LASER SENSORS

PHOTO-ELECTRIC SENSORS

AREA SENSORS

PRESSURE / FLOW SENSORS

PARTICULAR USE SENSORS

SENSOR OPTIONS

MEASURE-MENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

PLC

HUMAN MACHINE INTERFACES


FA COMPONENTS

MACHINE VISION SYSTEMS

Safety Light Curtains Safety Control Units

ST4

SW-100 Safety Devices

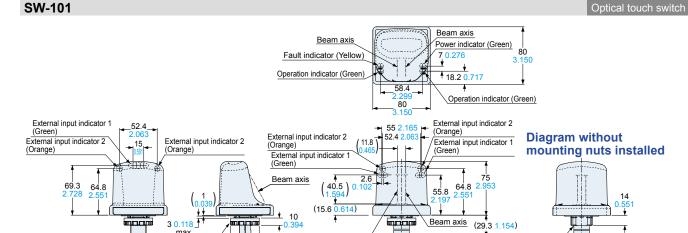


Panel cut-out dimensions

<When mounting with a resin plate>

Mounting nut

4.8 ^{+0.2} ₀ 0.189

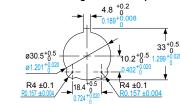

<When mounting with a metal plate>

Beam axis

-(21.7 <mark>0.854</mark>)


(16.1 (0.634)

ø40




Note: The panel thickness should be 3 mm 0.118 in or less.

SW-111 Optical touch switch

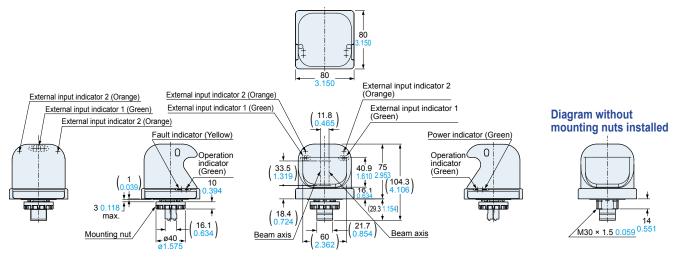


Panel cut-out dimensions

<When mounting with a resin plate>

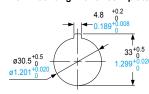

<When mounting with a metal plate>

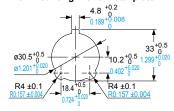

Note: The panel thickness should be 3 mm 0.118 in or less.